



# MULTI-USE GAMES AREAS (MUGAs)

## 2023/24 CONDITION INSPECTIONS

**VERSION:** 1.4  
**WRITTEN BY:** Neil Yates  
**IMPLEMENTED:** 13<sup>th</sup> Dec 2023

---

# CONTENTS

## TABLE OF CONTENTS

Contents	ii
<b>1.0 SUMMARY</b>	<b>1</b>
<b>2.0 GENERAL INFORMATION</b>	<b>2</b>
2.1 List of MUGAs	2
2.2 Asset Codes	3
2.3 Overall Condition Ratings	4
<b>3.0 OVERALL CONDITION RATINGS</b>	<b>5</b>
3.1 Specific Risk Rating	6
<b>4.0 DEFECTS IDENTIFIED</b>	<b>8</b>
<b>5.0 PROPOSED WORKS</b>	<b>13</b>
5.1 Routine Maintenance	13
5.2 Improvement Works	16
Appendices	iii

## LIST OF TABLES

2.1 List of MUGAs	2
2.2 Asset Codes	3
2.3 Overall Condition Rating Descriptions	4
3.1 Overall Condition Ratings	5
3.2 Risk Score Matrix	7
4.1 Defects Identified	8
5.1 Routine Maintenance	13
5.2 Improvement Works	16

## LIST OF APPENDICES

Appendix A MUGA Location Plan	iii
Appendix B Photographs of Identified Defects	iv

## **1.0 SUMMARY**

Inspections of the Council's Multi-Use Games Areas (MUGAs) took place in November 2023.

The assets were assessed in accordance with the information listed in Section 2.0.

This report details the findings of these inspections, providing an overall condition of each asset, listing the defects found and proposing repairs and/or improvement works required to resolve them.

## 2.0 GENERAL INFORMATION

### 2.1 LIST OF MUGAS

REF	MUGA	WARD
BBCMU01	Abel Street	Daneshouse with Stoneyholme
BBCMU02	Barden Gardens	Queensgate
BBCMU03	Burnley Wood	Rosehill with Burnley Wood
BBCMU04	Byerden Holme	Daneshouse with Stoneyholme
BBCMU05	Every Street	Trinity
BBCMU06	Forfar Street	Coal Clough with Deerplay
BBCMU07	Fulledge Recreation Ground	Bank Hall
BBCMU08	Hapton Recreation Ground	Hapton with Park
BBCMU09	Hargher Clough Park	Trinity
BBCMU10	Hargrove	Gawthorpe
BBCMU11	Healey Heights	Trinity
BBCMU12	Ightenhill Park	Whittlefield with Ightenhill
BBCMU13	Lancaster Drive	Hapton with Park
BBCMU14	Park Road	Gawthorpe
BBCMU15	Piccadilly Gardens	Trinity
BBCMU16	Queen's Park	Bank Hall
BBCMU17	Queen Street	Burnley
BBCMU18	Rakehead Recreation Ground	Queensgate
BBCMU19	Scott Park	Coal Clough with Deerplay
BBCMU20	Underley Street	Lanehead
BBCMU21	Vanguard	Trinity
BBCMU22	Whittlefield Recreation Ground	Gannow
BBCMU23	Worsthorne	Cliviger with Worsthorne

Table 2.1 List of MUGAs

## 2.2 ASSET CODES

Each defect identified is categorised in accordance with the codes shown below in Table 2.2.

CODE	ASSET
CWB	MUGA surface (bituminous)
CWNB	MUGA surface (non-bituminous)
FP	Footpaths
KC	Kerbs, edgings, pre-formed channels
IW	Covers, grates, frames, boxes
LC	Lighting columns, floodlights
MUGSF	MUGA fence, guardrail and safety fences
GPBH	Goal posts, basketball hoops
WA	Walls
HT	Hedges and trees
DE	Debris

Table 2.2 Asset Codes

### 2.3 OVERALL CONDITION RATINGS

An overall condition rating has been assigned to each asset to provide an indication of the general condition, highlight issues and to determine the frequency of inspections.

Each item was assigned a condition rating between 1\* and 5\*, with 1\* as the poorest rating and 5\* the highest.

RATING	DESCRIPTION	CONSEQUENCE
5*	Excellent	No works required.
4*	Very Good	Possible minor deterioration but overall of a high standard.
3*	Acceptable	Repairs to be carried out within five years.
2*	Poor	Repairs to be carried out within two to five years.
1*	Very Poor	Repairs to be carried out within one year, with some repairs to be undertaken sooner.

Table 2.3 Overall Condition Rating Descriptions

### 3.0 OVERALL CONDITION RATINGS

REF.	MUGA	CONDITION RATING (1* VERY POOR TO 5* EXCELLENT)				
		SURFACE	FENCE	ACCESS	LINE MARKINGS	LIGHTING
BBCMU01	Abel Street	2	4	3	2	5
BBCMU02	Barden Gardens	2	2	4	1	-
BBCMU03	Burnley Wood	5	4	5	4	5
BBCMU04	Byerden Holme	3	3	5	1	5
BBCMU05	Every Street	2	4	3	1	5
BBCMU06	Forfar Street	3	4	2	2	1
BBCMU07	Fulledge Rec.	4	4	4	1	1
BBCMU08	Hapton Rec.	2	3	4	1	1
BBCMU09	Hargher Clough Park	5	5	3	5	5
BBCMU10	Hargrove	2	4	4	1	-
BBCMU11	Healey Heights	4	4	5	3	-
BBCMU12	Ightenhill Park	4	4	4	2	-
BBCMU13	Lancaster Drive	3	3	5	1	5
BBCMU14	Park Road	2	4	5	3	1
BBCMU15	Piccadilly Gardens	3	2	2	1	-
BBCMU16	Queen's Park	4	3	5	1	-
BBCMU17	Queen Street	4	4	4	1	2
BBCMU18	Rakehead Rec.	4	4	5	1	1
BBCMU19	Scott Park	4	3	3	3	-
BBCMU20	Underley Street	4	3	3	1	5
BBCMU21	Vanguard	3	3	5	1	1
BBCMU22	Whittlefield Rec.	2	3	5	2	1
BBCMU23	Worsthorne	5	4	4	5	-

Table 3.1 Overall Condition Ratings

### 3.1 SPECIFIC RISK RATING

The risk scores are calculated by plotting the likelihood of harm against the severity of the injury sustained. The likelihood is given a score of 1 to 5 and the severity is given a score of 1 to 5.

In doing this a matrix is produced which gives a numerical assessment of the risk on a score of 1 to 25 and a judgement is made as to which risks are low, which are medium and which are high.

Risk scores may be adjusted in the light of experience and therefore may not be exactly as per the table. For example, a score of 7 may be noted.

Risks are calculated as follows –

- 1) An assessment of the likelihood of harm taking place is made using the numbers 1 to 5, by following these descriptions:

- 1 = Rare
- 2 = Unlikely
- 3 = Moderate
- 4 = Likely
- 5 = Certain

- 2) An assessment of the severity of the injury sustained is made using the numbers 1 to 5, by following these descriptions:

- 1) Insignificant
- 2) Minor
- 3) Moderate
- 4) Major
- 5) Catastrophic

- 3) The two numbers are multiplied to give a risk score on a scale of 1 to 25.
- 4) Scores of 1 to 7 inclusive are considered to be low risk and are considered to be tolerable where this is the innate risk of the item, but where remedial works are identified these should be undertaken.
- 5) Scores of 8 to 12 are considered to be medium risk and some control measures may be identified to reduce the risks to low, tolerable levels.
- 6) Scores of 13 and above are considered to be high risk and urgent action is considered to reduce the risks to tolerable levels.

It is important to note that where an outcome is catastrophic, but for which the likelihood is rare, this will present a score of  $1 \times 5 = 5$  = low risk. Similarly, a certain event for which the consequence is insignificant will present a score of  $5 \times 1 = 5$  = low risk. It is important to consider likelihood and consequence, rather than just one of the factors in isolation.



The multiplication of the factors into a risk matrix is given in Table ... below, with a judgement made as to risk scoring indicated by colour.

Green = LOW risk, Amber = MEDIUM risk, Red = HIGH risk.

LIKELIHOOD	SEVERITY				
	1 = INSIGNIFICANT	2 = MINOR	3 = MODERATE	4 = Major	5 = Catastrophic
1 = RARE	1 Low	2 Low	3 Low	4 Low	5 Low
2 = UNLIKELY	2 Low	4 Low	6 Low	8 Medium	10 Medium
3 = MODERATE	3 Low	6 Low	9 Medium	12 Medium	15 High
4 = LIKELY	3 Low	8 Medium	12 Medium	16 High	20 High
5 = CERTAIN	5 Low	10 Medium	15 High	20 High	25 High

Table 3.2 Risk Score Matrix

## 4.0 DEFECTS IDENTIFIED

Table 4.1 shows all the defects identified in the November 2023 inspections. The recommended repairs to rectify these defects are listed in Tables 5.1 and 5.2 in Section 5.0.

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION
BBCMU01	Abel Street	CWB	6	Surface is poor – minor damage, with poor overall slip resistance. Patch repairs have been carried out.
		MUGSF	1	Narrow entrance points restrict disabled access.
		MUGSF	1	Minor graffiti/paint on goal posts faded.
		HT	9	Trees have been removed from tree pits, together with some setts missing, causing a trip hazard.
BBCMU02	Barden Gardens	CWB	12	Minor damage and some settlement has occurred. Moss has grown over ¼ of the court surface.
		MUGSF	9	Upper lightweight fence panels at goal end are damaged and are likely to become detached from the posts.
		MUGSF	8	Bolt missing from upper fence panel.
		HT	6	Tree branch overhanging MUGA fence causing leaves to fall on the court and could affect the fence in future.
BBCMU04	Byerden Holme	CWB	1	Line markings are faded.
		MUGSF	1	Top rails on fence are missing.
		MUGSF	1	Some graffiti and scuffs on goal posts.
BBCMU05	Every Street	CWB	1	Minor damage and ponding occurring. Coloured surface has worn away reducing overall slip resistance.
		MUGSF	2	Minor rust on fence.
		MUGSF	1	Narrow entrance points restrict disabled access.
BBCMU06	Forfar Street	CWB	9	Small pothole near goal mouth.
		CWB	1	Narrow cracks in the court surface.
		CWB	6	Moss at the corner of the court.
		CWB	1	Line markings are faded and illegible.
		FP	1	Stepped access restricts disabled users.

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION
BBCMU06	Forfar Street	MUGSF	8	Fence panel adj. goal post has been bent outwards.
		MUGSF	8	Fence panel is detached from fixing.
		MUGSF	1	Goal posts have rusted.
		LC	1	4 No. floodlights are not working.
BBCMU07	Fulledge Recreation Ground	CWB	4	Moss has grown at the edges of the court and line markings faded.
		MUGSF	1	Fence panel is missing.
		MUGSF	8	5 No. bolts missing from fence panels.
		MUGSF	1	Goal posts are rusted.
		MUGSF	1	Cricket wicket is missing from fence.
		LC	1	4 No. floodlights are not working.
		FP	4	Disabled access affected by poor footpath link.
BBCMU08	Hapton Recreation Ground	CWB	6	Surface has deteriorated with weeds growing through in a few locations and moss has overgrown the surface in one corner.
		CWB	1	Line markings have faded and are illegible.
		MUGSF	1	Basketball backboards have rusted.
		MUGSF	4	Overall fence quality is poor but section near basketball hoop is broken.
		LC	1	2 No. floodlights are not working.
BBCMU09	Hargher Clough Park	CWB	1	Some weeds have grown along the fenceline.
		MUGSF	1	Narrow access points restrict disabled usage of the court.
BBCMU10	Hargrove	CWB	1	Ponding on path at MUGA entrance.
		CWB	6	MUGA surface has been damaged – possibly by fire.
		CWB	1	Overall MUGA surface is uneven, causing ponding at low spots.
		CWB	1	Line markings are faded and are illegible.
		HT	4	Vegetation growing through fence.

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION
BBCMU11	Healey Heights	CWB	4	Moss has grown at the edge of the court surface.
		CWB	1	Line markings have started to fade.
		IW	1	2 No. blocked gullies.
		MUGSF	1	Basketball backboards need to be replaced.
BBCMU12	Ightenhill Park	CWB	4	Moss has grown on the court surface.
		CWB	1	Line markings have started to fade.
BBCMU13	Lancaster Drive	CWB	1	Line markings are faded.
		MUGSF	1	Goal posts are rusted.
		MUGSF	4	Fence panels are leaning.
BBCMU14	Park Road	CWB	4	Coloured surface has started to deteriorate.
		MUGSF	4	Fence panels are leaning.
		MUGSF	1	Fence panel is missing at goal end.
		MUGSF	8	Basketball backboard has become detached from post.
		LC	1	4 No. floodlights not working.
BBCMU15	Piccadilly Gardens	CWB	4	Surface is starting to deteriorate and holding surface water.
		CWB	1	Line markings are faded and illegible.
		CWB	4	Moss has grown at the edge of the court surface.
		CWB	1	Disabled access is restricted due to step only access.
		MUGSF	9	Fence is not galvanised and is rusted.
		MUGSF	1	Low level fence will result in balls going outside of the court.
BBCMU16	Queen's Park	CWB	1	Line markings are faded and illegible.
		MUGSF	8	4 No. bolts missing from fence.
		MUGSF	1	Minor rust on goal posts.
		MUGSF	1	Basketball backboard is damaged.

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION
BBCMU17	Queen Street	CWB	1	Line markings are faded and are illegible.
		LC	1	Floodlight is lit during daylight hours.
BBCMU18	Rakehead Recreation Ground	CWB	1	Line markings are faded and are illegible.
		CWB	4	Minor damage to MUGA surface.
		MUGSF	1	MUGA fence scuffed with paint missing.
BBCMU19	Scott Park	CWB	1	Surface is starting to deteriorate and holding surface water.
		CWB	1	Line markings have started to fade.
		MUGSF	12	Goal post has rusted at point of connection with fence.
		MUGSF	1	Other sections of goal posts have rusted.
BBCMU20	Underley Street MUGA	CWB	1	Line markings are faded and are illegible.
		CWB	1	Path connection is in poor condition and affects disabled access.
		MUGSF	1	Goal posts are graffitied.
		MUGSF	4	Bolt missing in MUGA fence.
BBCMU21	Vanguard	CWB	4	Surface is starting to deteriorate and holding surface water.
		CWB	1	Line markings are faded and illegible.
		CWB	4	Moss has grown on the court surface.
		IW	1	ACO drain is blocked.
		LC	1	4 No. floodlights not working.
		MUGSF	1	MUGA fence is rusted in places.
		MUGSF	1	Fence panel at goal end is missing.
		MUGSF	8	Bolts missing in MUGA fence at 2 No. locations.
		MUGSF	4	Makeshift fence panel is damaged.
		WA	1	Coping stone on wall is missing.
LC	1	4 No. floodlights not working.		

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION
BBCMU22	Whittlefield Recreation Ground	CWB	4	Surface is starting to deteriorate and has been reinstated in places.
		CWB	1	Line markings are faded and illegible.
		CWB	1	Footpath connection from Ighten Road is in poor condition and will affect disabled access.
		MUGSF	4	Basketball backboard is damaged.
		MUGSF	1	Part of basketball backboard is damaged.
		MUGSF	1	Goal posts have rusted.
		LC	1	1 No. floodlight not working.

Table 4.1 Defects Identified

## 5.0 PROPOSED WORKS

### 5.1 ROUTINE MAINTENANCE

The following defects were identified during the inspection process and were considered to require repair.

REF.	MUGA	CODE	RISK RATING	DESCRIPTION	BUDGET COST
BBCMU01	Abel Street	MUGSF	1	Re-paint goal posts.	£500
		HT	9	Replace missing trees	£4,000
BBCMU02	Barden Gardens	MUGSF	8	Replace missing bolt.	£50
		HT	6	Remove overhanging branch from nearby tree.	£200
BBCMU03	Byerden Holme	CWB	1	Re-line faded markings.	£1,200
		MUGSF	1	Replace missing rails on fence.	£1,200
		MUGSF	1	Re-paint goal posts.	£500
BBCMU05	Forfar Street	CWB	9	Repair pothole.	£200
		CWB	6	Scrape off moss from surface and weedkill.	£200
		MUGSF	8	Repair damaged fence.	£300
		MUGSF	1	Repair damaged fence.	£300
		MUGSF	1	Remove rust and re-paint goal posts.	£1,000
		LC	1	Repair 4 No. floodlights.	£800
BBCMU07	Fulledge Recreation Ground	CWB	4	Scrape off moss and weedkill.	£100
		CWB	1	Re-line faded markings.	£1,200
		MUGSF	1	Replace missing fence panel.	£500
		MUGSF	8	Replace missing bolts.	£150
		MUGSF	1	Remove rust and re-paint goal posts.	£1,000
		MUGSF	1	Replace missing cricket wicket.	£250
		LC	1	Repair 4 No. floodlights.	£800

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION	BUDGET COST
BBCMU08	Hapton Recreation Ground	MUGSF	1	Remove rust and re-paint or replace basketball hoops.	£500/£2k
		MUGSF	4	Replace damaged fence panel or upgrade all fences.	£500/£30k
		LC	1	Repair 2 No. floodlights.	£800
BBCMU09	Hargher Clough Park	CWB	1	Weedkill affected areas.	£150
BBCMU10	Hargrove	HT	4	Cut back vegetation encroaching on playing surface.	£200
BBCMU11	Healey Heights	CWB	4	Scrape off moss and weedkill.	£150
		IW	1	Clear blocked gullies.	£200
BBCMU13	Lancaster Drive	MUGSF	1	Remove rust and paint goal posts.	£500
		MUGSF	4	Re-set leaning fence posts.	£1,500
		MUGSF	1	Replace damaged basketball backboards.	£3,000
BBCMU14	Park Road	MUGSF	1	Re-set leaning fence posts.	£500
		MUGSF	1	Replace missing fence panel.	£500
		MUGSF	8	Re-secure basketball backboard to post.	£100
		LC	1	Repair 4 No. floodlights.	£800
BBCMU16	Queen's Park	CWB	1	Re-line MUGA.	£1,200
		MUGSF	8	Replace missing bolts on fence.	£150
		MUGSF	1	Remove rust and paint goal posts.	£500
		MUGSF	1	Replace damaged basketball backboard.	£1,500
BBCMU17	Queen Street	LC	1	Replace photocell in floodlight.	£200
BBCMU18	Rakehead Recreation Ground	CWB	1	Re-line markings.	£1,200
		CWB	4	Patch repair damaged surface.	£800
		MUGSF	1	Re-paint affected areas of MUGA fence.	£800



REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION	BUDGET COST
BBCMU19	Scott Park	MUGSF	12	Replace rusted goal post.	£2,500
		MUGSF	1	Paint goal post.	£500
BBCMU20	Underley Street	MUGSF	1	Re-paint goal posts.	£500
		MUGSF	8	Replace missing bolt.	£50
BBCMU21	Vanguard	CWB	4	Moss to be removed as part of re-surfacing scheme.	£150
		IW	1	Clear blocked ACO drain.	£200
		MUGSF	1	Remove rust and re-paint.	£1,000
		MUGSF	1	Replace missing fence panel.	£500
		MUGSF	8	Replace 2 No. missing bolts.	£100
		MUGSF	4	Replace damaged fence panel.	£500
		WA	1	Replace missing coping stone.	£200
		LC	1	Repair 4 No. floodlights.	£800
BBCMU22	Whittlefield Recreation Ground	MUGSF	4	Replace basketball backboard.	£1,500
		MUGSF	1	Replace basketball backboard.	£1,500
		MUGSF	1	Remove rust and re-paint.	£500
		LC	1	Repair 1 No. floodlight.	£800

Table 5.1 Routine Maintenance

## 5.2 IMPROVEMENT WORKS


The following works were identified during the inspection process as opportunities to either resolve existing issues or provide betterment to the assets.

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION	BUDGET COST
BBCMU01	Abel Street	CWB	6	Re-surface MUGA – plane off existing and provide new coloured surface course.	£25,000
		MUGSF	1	Consider adjusting fence panels at goal ends to widen access points.	£1,000
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£3,500
BBCMU02	Barden Gardens	CWB	12	Re-surface MUGA – plane off existing and provide new coloured surface course.	£25,000
		MUGSF	9	Replace damaged/missing lightweight fence panels (bowling green end).	£7,500
BBCMU04	Byerden Holme	CWB	12	Provide new coloured surface course.	£15,000
		MUGSF	1	Provide new goal posts and basketball nets.	£5,000
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£1,500
BBCMU05	Every Street	CWB	1	Repair areas where ponding is occurring. Provide new slip resistant paint coating to surface.	£15,000
		MUGSF	2	Re-paint rusted fence panels.	£7,500
		MUGSF	1	Consider adjusting fence panels at goal ends to widen access points.	£1,000
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£4,500
BBCMU06	Forfar Street	CWB	1	Consider future re-surfacing scheme.	£25,000
		CWB	1	Re-line markings.	£1,200
		FP	1	Consider providing ramped access for disabled users.	£3,500
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£2,000
BBCMU07	Fulledge Recreation Ground	CWB	1	Consider future re-surfacing scheme.	£15,000
		FP	1	Consider providing ramped access at Mitella Street entrance.	£1,500
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£2,000

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION	BUDGET COST
BBCMU08	Hapton Recreation Ground	CWB	6	Plane off existing surface and provide new surface course.	£25,000
		CWB	1	Provide new markings as part of above surfacing works.	£1,200
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£1,500
BBCMU09	Hargher Clough Park	MUGSF	1	Consider adjusting fence panels to enable disabled access.	£1,000
BBCMU10	Hargrove	CWB	1	Consider re-surfacing/re-constructing to new levels.	£30,000
		CWB	6	Repair affected area or resolve issue by carrying out above scheme.	£5,000
		CWB	1	Re-line MUGA or resolve issue by carrying out above scheme.	£1,200
BBCMU11	Healey Heights	CWB	1	Re-line markings.	£1,200
		MUGSF	1	Replace basketball backboards.	£2,000
BBCMU12	Ightenhill Park	CWB	4	Scrape off moss and weedkill or consider applying coloured surface.	£500/£15k
		CWB	1	Re-line markings or provide new as a part of above scheme.	£1,200
BBCMU13	Lancaster Drive	CWB	1	Re-line markings.	£1,200
		MUGSF	1	Replace basketball backboards.	£2,000
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£2,500
BBCMU14	Park Road	CWB	4	Provide new coloured surface.	£25,000
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£2,500
BBCMU15	Piccadilly Gardens	CWB	4	Plane off existing and provide new surface course.	£25,000
		CWB	1	Carry out lining works as part of re-surfacing scheme.	£1,200
		CWB	4	Moss to be removed as part of re-surfacing scheme.	£300
		CWB	1	Consider ramped access to MUGA.	£5,000
		MUGSF	9	Replace fences.	£20,000
BBCMU17	Queen Street	CWB	1	Re-line markings.	£1,200
BBCMU18	Rakehead Recreation Ground	MUGSF	1	Consider raising height of fence at mill end.	£4,000
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£6,500

REF.	MUGA	ASSET CODE	RISK RATING	DESCRIPTION	BUDGET COST
BBCMU19	Scott Park	CWB	1	Consider providing new coloured surface course.	£15,000
		CWB	1	Carry out lining works as part of re-surfacing scheme.	£1,200
BBCMU20	Underley Street	CWB	1	Re-line markings.	£1,200
		CWB	1	Consider re-surfacing path connection.	£5,000
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£4,500
BBCMU21	Vanguard	CWB	4	Plane off existing and provide new surface course.	£25,000
		CWB	1	Carry out lining works as part of re-surfacing scheme.	£1,200
		LC	1	Upgrade floodlights by replacing halogen lamps to LED.	£2,000
BBCMU22	Whittlefield Recreation Ground	CWB	4	Plane off existing and provide new surface course.	£25,000
		CWB	1	Carry out lining works as part of re-surfacing scheme.	£1,200
		CWB	1	Re-surface section of path between Ighten Road and recreation ground.	£2,000

Table 5.2 Improvement Works

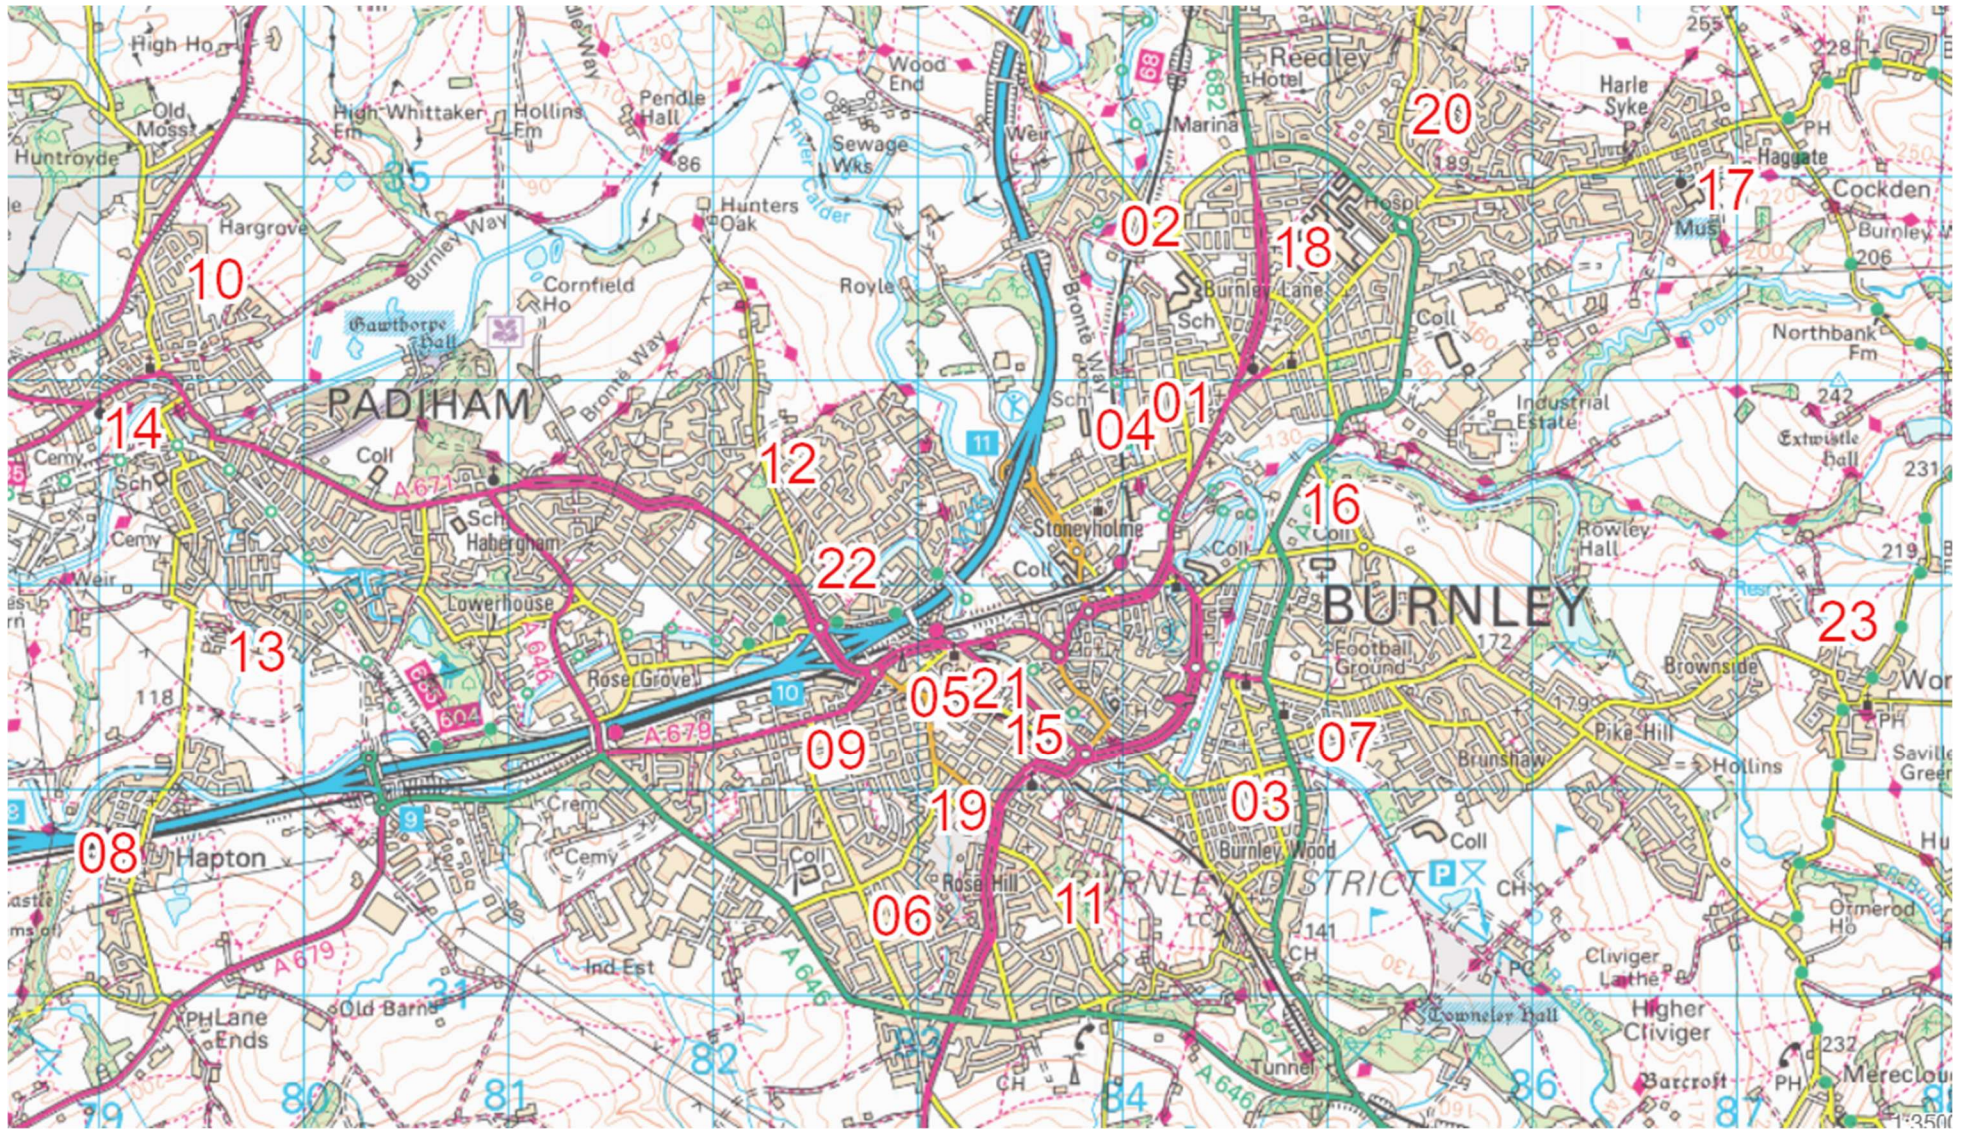

DEFECTS IDENTIFIED

BBCMU01 – Abel Street



MUGA surface in poor condition

BBCMU01 – Abel Street



Narrow entrance restricts disabled access

BBCMU01 – Abel Street



Graffitied/faded paint on goal posts

BBCMU01 – Abel Street




Voids at former tree pits/missing setts

BBCMU02 – Barden Gardens



MUGA surface in poor condition

BBCMU02 – Barden Gardens

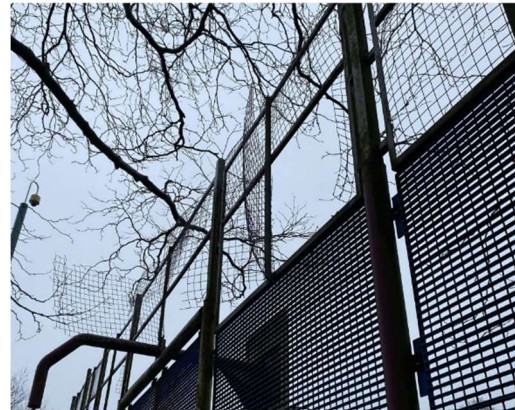

Damaged fence panels

BBCMU02 – Barden Gardens



Bolt missing from fence panel

BBCMU02 – Barden Gardens



Tree branch overhanging MUGA fence

BBCMU04 – Byerden Holme



Faded line markings

BBCMU04 – Byerden Holme



Top rails on fence missing

BBCMU04 – Byerden Holme



Scuffs/paint missing on goal posts

BBCMU04 – Byerden Holme



Paint on MUGA surface



BBCMU05 – Every Street



MUGA surface in poor condition

BBCMU05 – Every Street



Narrow surface restricts disabled use

BBCMU06 – Forfar Street



Pothole near goal mouth

BBCMU06 – Forfar Street



Cracks in MUGA surface

BBCMU06 – Forfar Street



Moss at the corner of the court

BBCMU06 – Forfar Street



Faded line markings

BBCMU06 – Forfar Street




Stepped access restricts disabled users

BBCMU06 – Forfar Street



Fence panel bent outwards

BBCMU06 – Forfar Street

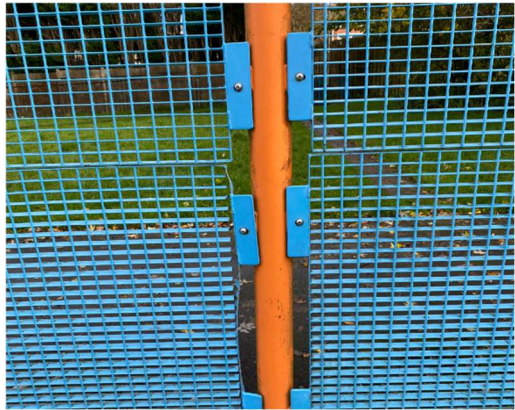

Fence panel detached from fixing

BBCMU06 – Forfar Street



Goal posts have rusted

BBCMU07 – Fulledge Recreation Ground



Moss at the edges of the court

BBCMU07 – Fulledge Recreation Ground



Missing fence panel

BBCMU07 – Fullede Recreation Ground



5 No. bolts missing from fence panels

BBCMU07 – Fullede Recreation Ground



Rusted goal posts

BBCMU07 – Fullede Recreation Ground



Cricket wicket missing from fence

BBCMU08 – Hapton Recreation Ground



MUGA surface in poor condition

BBCMU08 – Hapton Recreation Ground



Faded line markings

BBCMU08 – Hapton Recreation Ground



Rusted basketball backboards

BBCMU08 – Hapton Recreation Ground



Sections of fence in poor condition

BBCMU09 – Hargher Clough Park



Weeds along fenceline

BBCMU09 – Hargher Clough Park



Narrow access restricts disabled use

BBCMU10 - Hargrove



Weeds along fenceline

BBCMU10 - Hargrove



Damaged MUGA surface

BBCMU10 - Hargrove



Faded line markings

BBCMU10 - Hargrove



Vegetation growing through fence

BBCMU11 – Healey Heights



Moss on surface at edge of court

BBCMU11 – Healey Heights



Faded line markings

BBCMU11 – Healey Heights



2 No. blocked gullies

BBCMU11 – Healey Heights



Damaged basketball backboards

BBCMU12 – Ightenhill Park



Moss on MUGA surface

BBCMU12 – Ightenhill Park



Faded line markings

BBCMU13 – Lancaster Drive



Faded line markings



BBCMUI3 – Lancaster Drive



Rusted goal posts

BBCMUI3 – Lancaster Drive



Leaning fence

BBCMUI3 – Lancaster Drive



Damaged basketball backboards

BBCMUI4 – Park Road



MUGA surface in poor condition

BBCMUI4 – Park Road



Leaning fence

BBCMUI4 – Park Road



Missing fence panel

BBCMUI4 – Park Road



Basketball backboard detached from fence

BBCMUI5 – Piccadilly Gardens



MUGA surface holding water

BBCMU15 – Piccadilly Gardens



Faded line markings

BBCMU15 – Piccadilly Gardens



Moss grown on MUGA surface

BBCMU15 – Piccadilly Gardens



Steps restrict disabled access

BBCMU15 – Piccadilly Gardens



Fence is rusted

BBCMU16 – Queen’s Park



Faded line markings

BBCMU16 – Queen’s Park



4 No. bolts missing on fence

BBCMU16 – Queen’s Park



Rust on goal posts

BBCMU16 – Queen’s Park



Damaged basketball backboard

BBCMU17 – Queen Street



Faded line markings

BBCMU17 – Queen Street



Floodlight lit in daylight

BBCMU18 – Rakehead Recreation Ground



Faded line markings

BBCMU18 – Rakehead Recreation Ground



Damaged fence

BBCMU18 – Rakehead Recreation Ground



Damaged MUGA surface

BBCMU19 – Scott Park



MUGA surface holding water

BBCMU19 – Scott Park



Line markings starting to fade

BBCMU19 – Scott Park



Rusted goal post at fixing

BBCMU19 – Scott Park



Rusted goal post

BBCMU20 – Underley Street



Faded line markings

BBCMU20 – Underley Street



Path connection in poor condition

BBCMU20 – Underley Street



Graffitied goal posts

BBCMU20 – Underley Street



Bolt missing in fence

BBCMU21 - Vanguard



Faded line markings

BBCMU21 - Vanguard



Moss on MUGA surface

BBCMU21 - Vanguard



Blocked ACO drain




BBCMU21 - Vanguard



Rusted fence

BBCMU21 - Vanguard

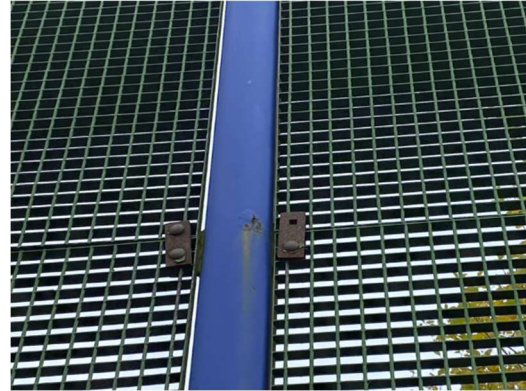


2 No. missing bolts in fence

BBCMU21 - Vanguard



Missing fence panel

BBCMU21 - Vanguard

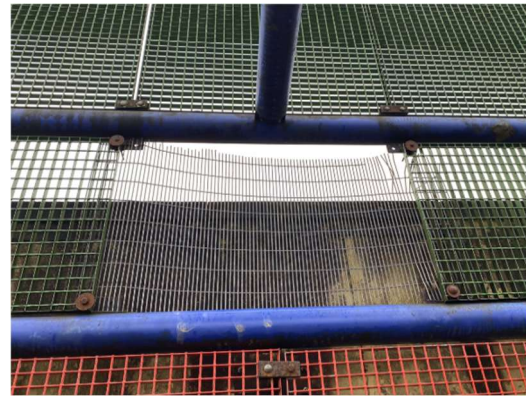

Damaged fence panel

BBCM U21 – Vanguard



Missing coping stone

BBCM U21 – Vanguard



MUGA surface in poor condition

BBCM U21 - Vanguard



Faded line markings

BBCM U22 – Whittlefield Recreation Ground



Footpath connection in poor condition

BBCMU22 – Whittlefield Recreation Ground



Damaged basketball backboard

BBCMU22 – Whittlefield Recreation Ground



Damaged basketball backboard

BBCMU22 – Whittlefield Recreation Ground



Rusted/scuffed goal posts